Technical DataSheet

VWR® ECO MOBCAP 2 ELASTIC BAND 10G PP

EU cat. No: 114-9772


CHARACTERISTICS


- Made of 10g non-woven SPP fabric
- White colours with 53cm
- Nature Rubber Latex Free
- Double elastics
- Comply with European Commission Directive 1935/2004/EC, Regulation (EU) No.10/2011, Regulation (EU) No.2016/1416 and Regulation (EU) 2017/752.

PHYSICAL PROPERTIES

Item		Test method	Standard
Weight(g/m2)		ISO3801	10±2
Break Tensile Properties (N/5cm)	MD	ISO13934-1	>12
	CD	ISO13934-1	>6
Elongation Rate(%)	MD	ISO13934-1	>30
	CD	ISO13934-1	>30

PRODUCTS AND DIMENSION SPECIFICATION



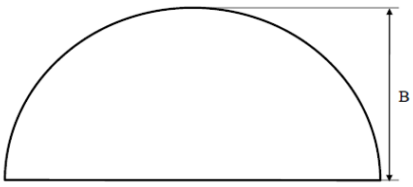

Unit: CM

ECN	Colour	Size	A	A'	B
114-9772	White	53	21	53	26

Remark: A: Relax, A': Stretch

Imported by VWR International bv
Address: Researchpark Haasrode 2020, Geldenaaksebaan 464, B-3001 Leuven
E-mail: vwr.be@vwr.com

PACKAGING AND STORAGE

Package/Quantity	100pcs/bag, 10bags/case
Best Storage Conditions	Temp : 0- 50°C,
	Humidity 45-85%
	without sunshine exposure
Country of Origin	China

QUALITY ASSURANCE CRITERIA

1. Dimension and Function - Critical (AQL1.5, S-2)
- Product dimension out of spec.
- Fabric characteristics out of spec

2. Visual Inspection/ Attributes - Major (AQL 2.5, L-II)
- Foreign Material
- Dirt
- Thread ends loose or too long(over 1cm)
- Holes/Tears
- Foul odor
- Discolor
- Wrong collar tag
- Wrong stitch
- Cloth surface applied wrongly
- Less than 6 stitches per inch
- Dimension tolerance not meet ±1inch for elastic and ±0.5inch for rest

3. Visual Inspection/Attributes - Minor (AQL 4.0, L-II)
- Sewing sundries
- Elastic band end exposed
- Sewing end falling-off
- Jumping Stitch
- Missing stitch
- Unwanted folds
- Elastic tightness non-consistent

Date of Issue: Nov 18, 2025