Technical DataSheet

VWR® ECO SHOECOVER 40G PP

EU cat. No: 114-9813


CHARACTERISTICS

- Made of 40g non-woven SPP fabric
- White colour
- Size with 17x41cm
- Nature Rubber Latex Free
- Comply with European Commission Directive 1935/2004/EC, Regulation (EU) No.10/2011, Regulation (EU) No.2016/1416 and Regulation (EU) 2017/752.

PHYSICAL PROPERTIES

Item		Test method	Standard
Weight(g/m2)		ISO3801	40±5
Break Tensile Properties (N/5cm)	MD	ISO13934-1	>50
	CD	ISO13934-1	>30
Elongation Rate(%)	MD	ISO13934-1	>30
	CD	ISO13934-1	>30

PRODUCTS AND DIMENSION SPECIFICATION

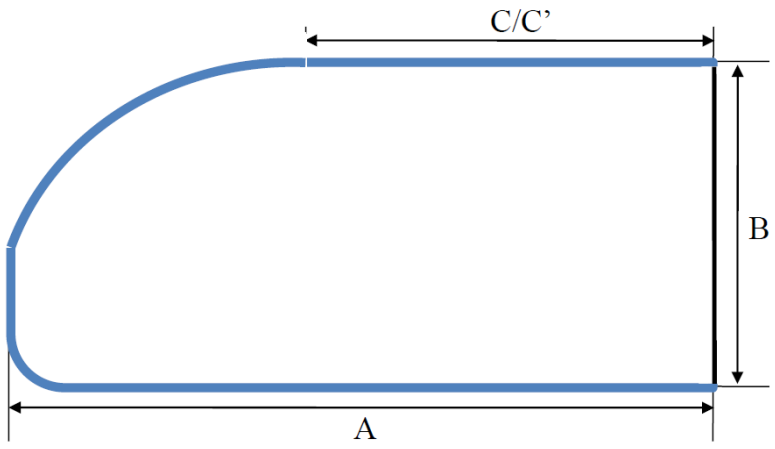

Unit: CM

ECN	Colour	Size	A	B	C	C'
114-9813	White	17x41cm	41	17	13	30

Remark: C: Relax, C': Stretch

Imported by VWR International bv
Address: Researchpark Haasrode 2020, Geldenaaksebaan 464, B-3001 Leuven
E-mail: vwr.be@vwr.com

PACKAGING AND STORAGE

Package/Quantity	100pcs/bag, 3bags/case
Best Storage Conditions	Temp : 0- 50°C,
	Humidity 45-85%
	without sunshine exposure
Country of Origin	China

QUALITY ASSURANCE CRITERIA

1. Dimension and Function - Critical (AQL1.5, S-2)
- Product dimension out of spec.
- Fabric characteristics out of spec
- Sonic welding strength less than 15N/5cm

2. Visual Inspection/ Attributes - Major (AQL 2.5, L-II)
- Foreign Material
- Dirt
- Thread ends loose or too long(over 1cm)
- Holes/Tears
- Foul odor
- Discolor
- Wrong collar tag
- Wrong stitch
- Cloth surface applied wrongly
- Less than 6 stitches per inch
- Dimension tolerance not meet ±1inch for elastic and ±0.5inch for rest

3. Visual Inspection/Attributes - Minor (AQL 4.0, L-II)
- Sewing sundries
- Elastic band end exposed
- Sewing end falling-off
- Jumping Stitch
- Missing stitch
- Unwanted folds
- Elastic tightness non-consistent

Date of Issue: Nov 18, 2025